
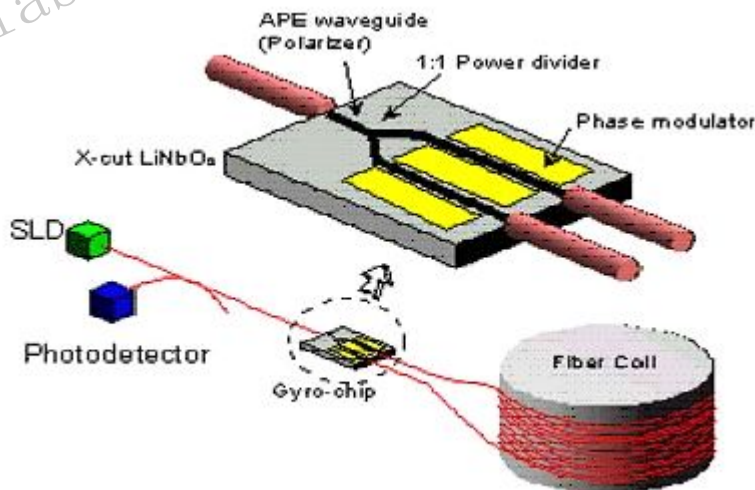


## Integrated Optic Chip for Gyroscope (Y waveguide modulators)

### 1. Chip structure

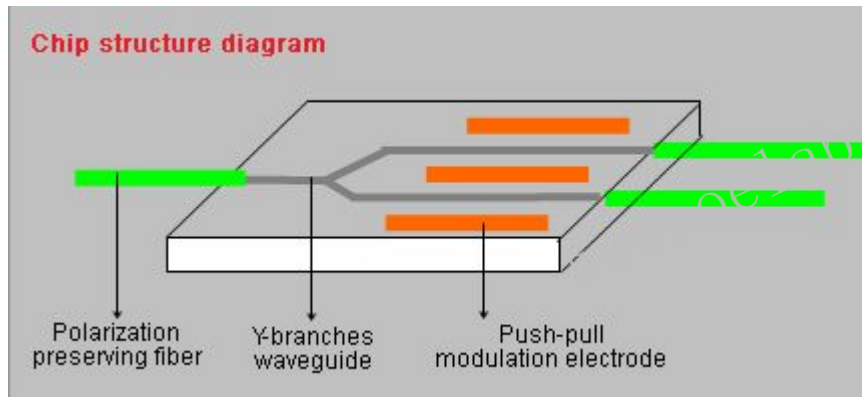

**Model: IOC-15-09-09-N**

**1550nm integrated optical chips ( Y waveguide) input/output: 125/250um PM fiber, 1m fiber length, without connector**

### 2. Applications

It is for attitude control of movements such as aircrafts, ships, guided missiles, automobiles etc in the fiber gyroscope system, Hydrophone and other optic sensitive fields. Faraday Effect was used to measure current through fiber circuit in the current sensing system.

Oelabs Inc.

Add: 1265, Ouimet, app.10, Montreal Q.C.Canada H4L 3P8

www.oelabs.com    Email: sales@oelabs.com

### 3. Features:

X-Cut, y-propagating LiNbO<sub>3</sub>

Very low insertion loss.

APE process for waveguide, works in single polarization

High extinction ratio

Fiber is sloping coupled with waveguide, which deduce optical return far and away

Push-pull electrode design may deduce half wave Voltage

Small packaging and lightweight

Excellent long-term stability

### 4. Specifications

Parameter	Unit	Values
Wavelength	nm	1550
Insertion	dB	≤4.0
Half wave Voltage	V	≤4.5
Splitting Beam Ratio	-	47/53—53/47
Optical Return	dB	≥50
Polarization extinction ,chip	dB	≥55
Additional Intensity Modulating	-	≤0.2%
PM Pigtail Crosstalk	dB	≤-30
Electrode type	-	Push-pull modulating
Bandwidth	MHz	≥300
Pigtail type	-	PM
Work temperature	°C	-40~+70
Packaging dimensions	mm	30X8X5 or 35X10X5

### 5. Product photo and outline




Oelabs Inc.

Add: 1265. Ouimet, app.10, Montreal Q.C.Canada H4L 3P8

www.oelabs.com Email: sales@oelabs.com

## 6. Package outline:

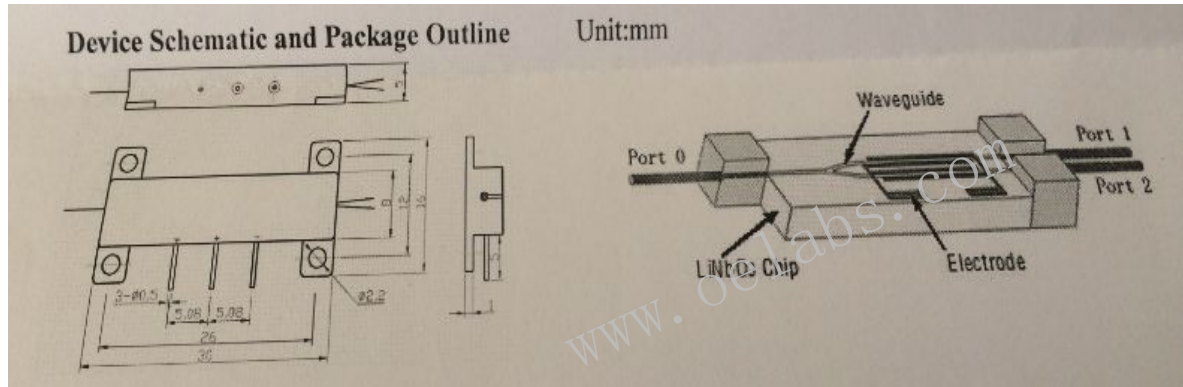

**We can provide different pigtail and package by customer requirement .Welcome to contact us**

## 7. Operation Instructions

- a). If the devices work under the single state of polarization, the polarization state of input light must conform to devices.
- b). Avoid the Electrical damage of the devices; the electrode voltage of modulators should be lower 30V.
- c) .Applying too much force to fiber may cause it broking easily. Avoid drawing、twisting. Bending radius must not be less than 30nm.
- d) Avoid too much force between metal tube and fibers. Put up the tube and the fibers together when using it. Avoid bending at the joint of the tube and the fibers.
- e) Storage environment humidity must be less than 50%, and not contain the materials which damages devices.
- f) Avoid the devices suffering from intense thermal shock and inhomogeneous by heated.
- g) Avoid stressing to the joint of the fiber connection circuits.